

SECTION CORNER RECORD

NB4-S.5-E.5

VERMILLION COUNTY SURVEYOR'S OFFICE

State Plane grid coordinates NAD83 (2011):

North: 1696460.56 East: 2837965.48 (U.S. survey feet)

Type of monument: 5/8" diameter rebar, 30" long, with aluminum cap
stamped 'Vermillion County Surveyor', 0.1' above grade


Indiana tie card references:

IN02_T17NR10W28_40

CORNER WITNESS DETAIL


SCALE 1" = 20'
0' 10' 20'


A - S.W. edge 28" dia. Oak, flush, 40.5'
B - W. edge 14" dia. Maple, 1' a.g., 14.8'
C - N. edge 20" dia. Walnut, 1' a.g., 10.9'

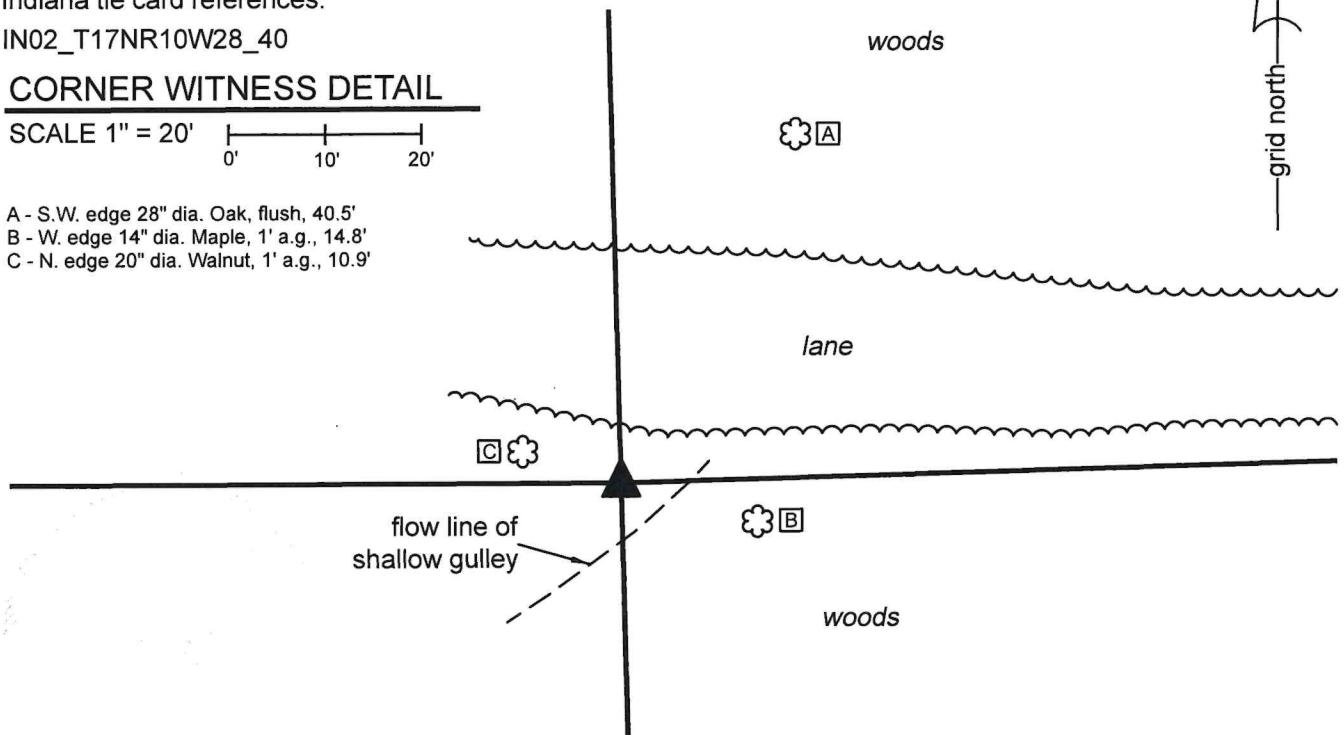

The rebar with Vermillion County cap was set in place of a rebar found. This found rebar is shown as being set on a survey by J. Reese Harpel, LS No. 20000203, on a survey recorded as Instrument 2017000252. The found rebar is on the edge of a shallow gulley. Fencing in the immediate vicinity of the corner is impacted by the presence of the gulley, though the rebar was in-line with existing fencing further east, west, and south. The position of the rebar fits well with evidence of proximate corners and fits well with original federal dimensions for the fractional east half of the section, as reported at the north and south lines of Section 28. This is an irregular section wherein the eastern portion is fractional as surveyed from the west, terminating on the range line between Ranges 9 and 10 West. No other evidence of the corner was found. The position established by Harpel was held as the best available evidence of the corner. The existing 24-inch rebar was replaced with a 30-inch length of rebar with metal cap stamped 'Vermillion County Surveyor' on November 7, 2025.

2026000243 SECT COR \$0.00
02/09/2026 01:31:36P 2 PGS
Florinda A Pruitt
Vermillion County Recorder IN
Recorded as Presented

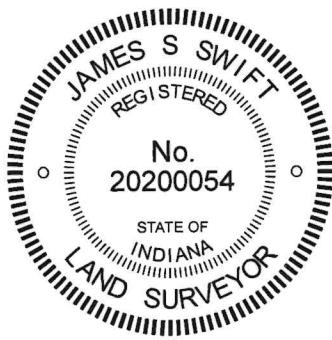

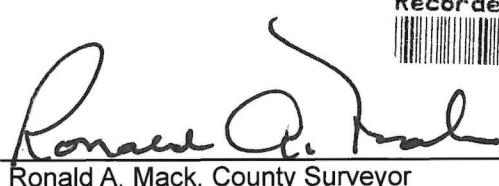
Ronald A. Mack, County Surveyor


2/9/26

Section 28
T17N, R10W

James S. Swift, IN LS 20200054

February 6, 2025

Vermillion
Township

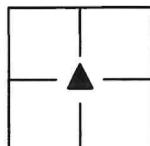

VERMILLION COUNTY SURVEYOR'S OFFICE NB4-S.5-E.5

PHOTOGRAPHIC DOCUMENTATION


Date of photography: November, 2025



The rebar as found



The rebar with Vermillion County Surveyor Cap

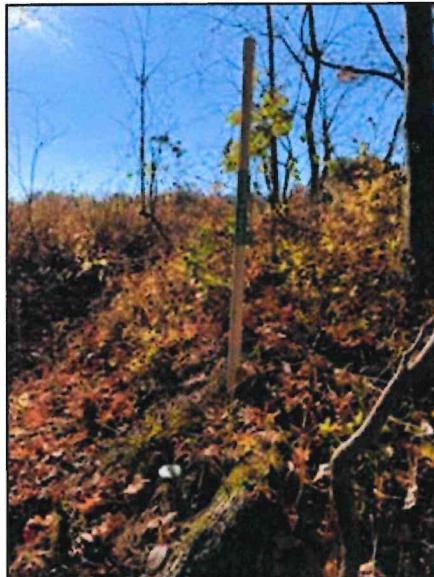

View of vicinity of monument



View of vicinity of monument

For details and documentation, refer to
related sheet "Section Corner Record."