

# SECTION CORNER RECORD

## VERMILLION COUNTY SURVEYOR'S OFFICE

NE5-E  
& NE5-W

State Plane grid coordinates NAD83 (2011):

Corner 1: North: 1713487.87 East: 2839025.99 (U.S. survey feet)

Corner 2: North: 1713830.19 East: 2839026.03 (U.S. survey feet)

Type and depth of monument: Stone

Corner 1: Stone, flush

Corner 2: Stone, 6" above grade

Indiana tie card references:

IN02\_T18NR9W31\_72 IN02\_T17NR10W09\_26

IN02\_T17NR9W06\_00

### CORNER WITNESS DETAIL

SCALE 1" = 50'  
0' 25' 50'

SEC. 9, T 17 N, R 10 W

C/L State Road 234

SEC. 31, T 18 N, R 9 W

① S.W. Corner, Section 31  
T 18 N, R 9 W  
N.W. Corner, Section 6  
T 17 N, R 9 W  
CORNER REFERENCE: NE5-E


② N.E. Corner, S.E. 1/4,  
N.E. Frac. 1/4, Section 9  
T 17 N, R 10 W  
CORNER REFERENCE: NE5-W

Distance between  
monuments: 342.5'

- A - Vermillion County witness mark, flush, 13.3' (to①)
- B - Vermillion County witness mark, flush, 14.5' (to①)
- C - Vermillion County witness mark, flush, 40.0' (to①)
- D - Wood line post, flush, 118' (to①)
- E - rebar with "WL Clark" cap, flush, 0.9' (to②)
- F - Vermillion County witness mark, flush, 18.8' (to②)

Vermillion County witness mark is a 3/8" diameter x 2' long rebar  
bearing a metal cap stamped "Vermillion County Witness Point."


2026000236 SECT COR \$0.00  
02/09/2026 01:16:26P 3 PGS  
Florinda A Pruitt  
Vermillion County Recorder IN  
Recorded as Presented

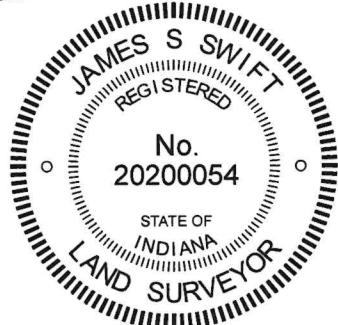


Ronald A. Mack 2/9/26  
Ronald A. Mack, County Surveyor

J. S. Sct

James S. Swift, IN LS 20200054  
February 6, 2026 Page 1 of 2

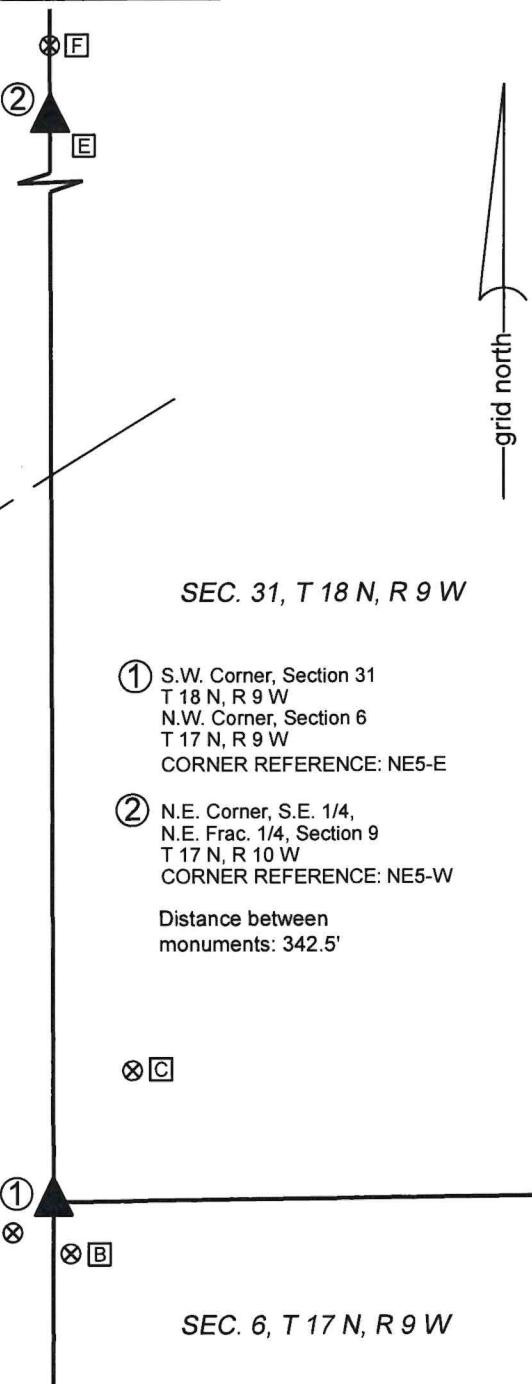

Eugene Township

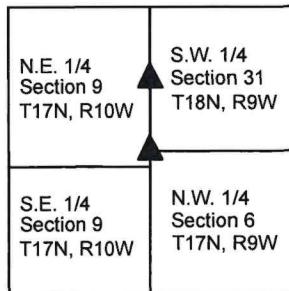

# SECTION CORNER RECORD

## VERMILLION COUNTY SURVEYOR'S OFFICE

NE5-E  
& NE5-W

### Written Documentation Sheet

Please refer to page 1 of 2 for other information.

The stones at both corners were found in place and held as marking the respective corners. The Stone at Corner 1, as found in the field, appeared to have fallen over, leaning toward the northeast and has a "+" mark on the northeastern side. The top, center point of the stone, as found was held as found. The stone was not stood up or otherwise disturbed. This stone is believed to have been held by previous surveyors though no references to it were found on surveys recorded in the Office of the Vermillion County Recorder.

The stone at Corner 2 was found standing vertically, with no specific marks, at the southeast edge of an old wood corner post. The top of the stone appeared to have been sheered off from the main body, presumably through freeze-thaw processes, and was found lying nearby. A rebar with cap stamped 'WL Clark IN S0013' was found 0.9-foot southwest of the center of the stone.


Corner 1 represents the northwest corner of Section 6, Township 17 North, Range 9 West and southwest corner of Section 31, Township 18 North, Range 9 West. Corner 2 represents the northeast corner of the southeast quarter of the northeast quarter of Section 9, Township 17 North, Range 10 West.

The stone at corner 2 appears to be the same monument as is shown on the plans for State Road 234, Fiscal Year 1935, Project No. 557, and the stone at Corner 1 appears to be in the position shown for that corner on those plans. It is noted that the 1935 plans show Corner 2 as being the northeast corner of Section 9 and southeast corner of Section 4, both in Township 17 North, Range 10 West, but that is not correct. Corner 2 is approximately one-quarter mile south of that particular corner.

These stones are referenced as marking both corners on a survey by Norman Hiselman recorded as Instrument 2024002089 in the Office of the Vermillion County Recorder's Office. The stone at Corner 2 is referenced as marking that corner on several surveys, including a survey by Todd Starr recorded as Instrument 2011001538 and a survey by Easton French recorded as Instrument 2024002179.

It is noted that these corners fall along the range line between Ranges 9 West and 10 West. This is an irregular range line insofar as the sections on both sides are fractional and the existing, relevant corners along the line are all closing corners. Standard corners were established in 1819 but were never held as corners for the sections in Range 10 West, as those sections were surveyed in from the west and close on the range line, resulting in fractional sections to the west of the range line. No cross-referenced distances are known to have been recorded between the corners for the sections in the two ranges. Given the irregularity of the range line and the fact that no true standard corners remain as relevant to the adjoining sections, no attempt is made to adjust one corner or the other to a longer line connecting standard corners, as would likely be the case on other range lines, where standard corners control the location of the longer line. The range line between the two corners is held as the line connecting the two stones.

Corner 2 is a quarter-quarter corner. Given that the stone marking this corner is known to have been held as marking the corner since at least 1935 (fiscal year of the plans for State Road 234) we have held the stone as marking the corner. As noted above, the state highway plans incorrectly identify it as a section corner, but subsequent surveys, including those referenced above, call it as the quarter-quarter corner.

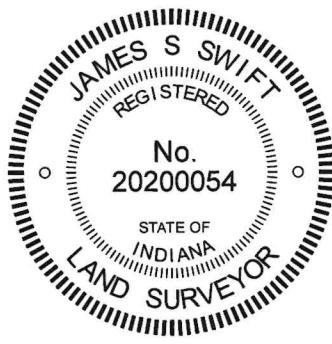


Ronald A. Mack, County Surveyor

A handwritten signature in black ink that reads "Ronald A. Mack" followed by "County Surveyor".

James S. Swift, IN LS 20200054

February 6, 2026 Page 2 of 2

Eugene Township

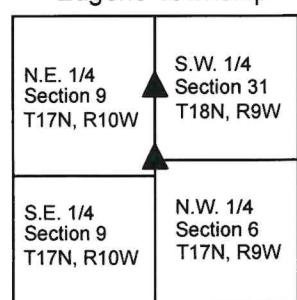

# VERMILLION COUNTY SURVEYOR'S OFFICE

## PHOTOGRAPHIC DOCUMENTATION

Date of photography: 2025

NE5-E

& NE5-W



The stone as found and viewed from the North  
(NE5, Corner 1)



The stone as found and viewed from the West  
(NE5, Corner 1)



The stone and rebar as found and  
viewed from the Southeast  
(NE4-S.25, Corner 2)



The stone and rebar as found and  
viewed from the Southeast  
(NE4-S.25, Corner 2)

For details and documentation, refer to  
related sheet "Section Corner Record."